



# MICROCHIP PIC18F6390/6490/8390/8490

## PIC18F6390/6490/8390/8490 Rev. C0 Silicon Errata

The PIC18F6390/6490/8390/8490 Rev. C0 parts you have received conform functionally to the Device Data Sheet (DS39629C), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F6390/6490/8390/8490 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

The following silicon errata apply only to PIC18F6390/6490/8390/8490 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F6390	0000 1011 101	0 0101
PIC18F6490	0000 0110 101	0 0101
PIC18F8390	0000 1011 100	0 0101
PIC18F8490	0000 0110 100	0 0101

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in binary in the format "DEVID2 DEVID1".

All of the issues listed here will be addressed in future revisions of the PIC18F6390/6490/8390/8490 silicon.

### 1. Module: Master Synchronous Serial Port (MSSP)

Configured in SPI slave mode, the MSSP will generate a write collision if SSPBUF is updated and the previous SSPBUF contents have not been transferred to the shift register.

Reinitializing the MSSP – by clearing and setting the SSPEN bit (SSPCON1<5>) prior to rewriting SSPBUF – will *not* prevent the error condition.

#### Work around

Prior to updating the SSPBUF register with a new value, verify that the previous contents have been transferred by reading the BF bit (SSPSTAT<0>). If the previous byte has *not* been transferred:

- Update SSPBUF
- If necessary, clear the WCOL bit (SSPCON1<7>)

#### Date Codes that pertain to this issue:

All engineering and production devices.

### 2. Module: Master Synchronous Serial Port (MSSP) – Serial Peripheral Interface (SPI)

In SPI mode, the Buffer Full flag (BF bit in the SSPSTAT register), the Write Collision Detect bit (WCOL in SSPCON1) and the Receive Overflow Indicator bit (SSPOV in SSPCON1) are not reset upon disabling the SPI module (by clearing the SSPEN bit in the SSPCON1 register).

For example, if SSPBUF is full (BF bit is set) and the MSSP module is disabled and re-enabled, the BF bit will remain set. In SPI Slave mode, a subsequent write to SSPBUF will result in a write collision. Also, if a new byte is received, a receive overflow will occur.

#### Work around

If if the buffer is full, before disabling the MSSP module, ensure that:

- SSPBUF is read (thus clearing the BF flag)
- WCOL is clear

If the module is configured in SPI Slave mode, ensure that the SSPOV bit is clear before disabling the module.

#### Date Codes that pertain to this issue:

All engineering and production devices.

### 3. Module: Master Synchronous Serial Port (MSSP) – I<sup>2</sup>C™

In the 10-Bit Slave mode, the I<sup>2</sup>C™ mode does not work correctly.

#### Work around

None.

#### Date Codes that pertain to this issue:

All engineering and production devices.

# PIC18F6390/6490/8390/8490

---

## 4. Module: Master Synchronous Serial Port (MSSP) – I<sup>2</sup>C™

When configured for I<sup>2</sup>C™ slave reception, the MSSP module may not receive the correct data in extremely rare cases. This occurs only if the Serial Receive/Transmit Buffer (SSPBUF) register is not read within a window after the SSPIF interrupt (PIR1<3>) has occurred.

### **Work around**

The issue can be resolved in either of these ways:

- Prior to the I<sup>2</sup>C slave reception, enable the clock stretching feature.

This is done by setting the SEN bit (SSPCON2<0>).

- Each time the SSPIF is set, read the SSPBUF before the first rising clock edge of the next byte being received.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## 5. Module: Master Synchronous Serial Port (MSSP) – I<sup>2</sup>C™

The I<sup>2</sup>C™ transmission will not work correctly in the MSSP module when it is configured for the I<sup>2</sup>C Master mode and the device is operating below 3V. The failure can be that the I<sup>2</sup>C data and clock are not coming out or that a false Acknowledgement is received (ACKSTAT (SSPCON2 <7>) = 0) even if no slave was addressed on the bus.

### **Work around**

None.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## REVISION HISTORY

Rev A Document (9/2007)

First release of this document. Includes silicon issues 1-3 (MSSP).

Rev B Document (1/2009)

Added silicon issues 4-5 (MSSP – I<sup>2</sup>C).

# PIC18F6390/6490/8390/8490

---

NOTES:

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, rfPIC, SmartShunt and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, PICkit, PICDEM, PICDEM.net, PICtail, PIC<sup>32</sup> logo, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rfLAB, Select Mode, Total Endurance, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2009, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949:2002 ==**

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



---

---

## WORLDWIDE SALES AND SERVICE

---

---

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-4182-8400  
Fax: 91-80-4182-8422

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-572-9526  
Fax: 886-3-572-6459

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-536-4803

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820